

Firmware Updates

For more information, contact our team on - technical.support@sonifex.co.uk

DHY-03 Firmware Versions		
Version	Changes	Description
V1.68	Alterations	Cisco ATA 187 code decreased threshold
V1.65	Alterations	Added Cisco code [110] for Al Jazeera TV
V1.64	Alterations	Added Avaya Media Gateway Country Code [111] for Al Jazeera TV
V1.61	Alterations	Line Reversal Min set to 35ms & ring timeout increased from 3 → 7 secs
V1.59	Alterations	Changed Line Reversal – now detects single reversal present for disconnect min parameter duration (ms)
V1.57	Alterations	Optional AGC on Receive Gain
V1.55	Bug fixes	Fixes for V1.54 country code issues
V1.55	Bug fixes	Fixes for V1.54 country code issues
V1.54	Alterations	New Japan2 country-code with custom remote and impedance settings
V1.45	Alterations	Added divert relay function to DHY-03 standard code (already present in EC); Added ability to switch off divert relay function – parameter 2 bit 7 enables relay (default operation); Added debug info if boot fails (LED codes 1–5); Added delay after divert relay release to maintain call if DHY-03 drops
V1.45	Alterations	RX and TX LEDs restored to correct values
V1.43	Alterations	RX and TX LEDs restored to correct values; Altered New Zealand Disconnect cadences
V1.41	Alterations	Added revision of Silabs chipset version number
V1.40	Alterations	New CC parameters: Display_Type, Adaption_Differential, Adaption_Response
V1.32	Alterations	CCs for AVAYA have new settings
V1.31	Alterations	Japan disconnect set to Line Reverse; Fix LINE_OUTPUT double precision mult io_mac
V1.30	Alterations	Changed limiter calculation of signal received from line
V1.29	Alterations	Added Line In to Tele Out Jumper Mode
V1.28	Alterations	JP2 Jumper Function non-operative – fixed
V1.27	Alterations	Distortion on telephone limiter when noise gate disabled
V1.21	Alterations	Added Avaya disconnect type 375/375ms 400Hz; Disconnect tone levels multiplied by 4 for finer control (requires any User Tones previously defined to have threshold level set 4x higher)
V1.21	Bug fixes	Wrong User Disconnect Tones were previously set by SCi
V1.19	Alterations	New settable line_overload param (P27 current set, P52/77/102/127/152/177 for Telephone Interface user sets); New DT_PERMANENT disconnect type for permanent line hold; Added Country Code 118 for Broadcast Bionics/Avaya with permanent line hold
V1.14	Alterations	Added BB/Avaya as country code 119; Added Avaya disconnect tone – 400Hz 375ms On/Off cadence; Default disconnect time extended to 500ms
V1.14	Bug fixes	Cadence disconnect bug fixed
V1.11	Release	Initial release